California Antique Slots, Inc. - (805) 583-0785 (FAX)

www.california-antique-slots.com tbaker@california-antique-slots.com Mills BONUS - Model -Item: Remedy: Problem: Reason: Letters are in order on reel strip from top to bottom Reel #1 Comments: Bar - "**O**" () -Orange - "N" Comments: () -Cherry - "U" Comments: () -Lemon - "**S**" Comments: () -Orange - "B" Comments: () -Sprocket Assembly Sprocket Cusp Idler Disk Bearing Lever Roller Bearing Notch On Idler Disk Flat Spring Rotate to correct letter as shown in annunciator Reset Idler Disk? (Y/N) Annunciator Cam - "B" Cam - "O" Cam - "N" Cam - "U" Index Cam Lever

California Antique Slots, Inc. - (805) 583-0785 (FAX)

www.california-antique-slots.com

tbaker@california-antique-slots.com

Item:	Problem:	Remedy:	Reason:
Notch			
Sensor			
Index Shaft			
Cam - "S"			
Inner/Outer	(Cession)	Degrease the	Cams MUST spin freely!
Cams		area between	If they do not, the "B"
		the cams. Use	will trigger an unwanted
Idler Notch		degreaser.	coin pay.
Sensing			
Linkage			
Notch			
Sensing			
Lever			
Bonus Payout			
Sensing			
Lever			
Bonus			
Sensing			
Lever			
Main			
Operating			
Link			
18 Coins	If no payout, check for jam in payout slides, tube, etc. The		
Payout?	number of coins from a BONUS is the same as generated		
(Y/N)	by a Bell/Bell/Bell win.		

Note: All metal/metal regions are "light oil only, sparingly applied." Sometimes, it is better to clean thoroughly and have no lubrication whatsoever. DO NOT USE any water displacement sprays. Use a cotton swab dipped in a premium light sewing machine oil to lubricate the hard-to-reach areas. For the cams pictured above, try using a length of dental floss soaked in degreaser. Gently enter the small opening and clean the region thoroughly... do not tear the floss or leave remnants.